

ML 393 Standard

Alarm	Res.	DLL	Font Card	15 cpi	17.1 cpi	20 cpi	Prop.	Cause / Treatment
Master CPU	-	-	On	-	-	-	On	Replace master CPU
Program ROM	-	-	On	-	-	On	-	Replace program ROM
Resident CG	-	-	On	-	-	On	On	Replace CG ROM
Optional CG	-	-	On	-	On	-	-	Replace
Slave CPU	-	On	-	-	-	-	On	Replace slave CPU
Master/ Slave Revision	-	On	-	-	-	On	-	Replace master or slave firmware to same level.
External RAM Error	-	On	On	-	-	-	On	Replace External RAM
Switch status table	On	-	-	-	-	-	-	Switch status table data abnormal
Command error 1	On	-	-	-	-	-	On	Slave CPU detected undefined command from CPU
Command error 2	On	-	-	-	-	On	-	Slave CPU detected undefined command from switch panel
Abnormal slave operation	On	-	-	-	-	On	On	Ram data fault
Space Motor Position	On	-	-	-	On	-	-	Space motor fault
Space motor overrun	On	-	-	-	On	On	On	Space motor fault
Print Overrun	On	-	On	-	-	-	On	Internal data transfer error
Print stop error	On	-	On	-	-	On	-	Space motor Slave CPU error
Print head homing	On	-	On	-	-	On	On	Print head failed to find home position
EEPROM	On	-	On	-	On	On	-	Replace EEPROM
Space Motor	On	-	On	-	On	On	On	Space motor error
Ribbon Error	On	-	On	On	-	On	On	Ribbon home position cannot be found
Bail arm error	On	-	On	On	On	-	-	Bail arm/sensor broken
Fan Alarm	On	On	-	-	-	-	-	PSU fan error