

ML 395

Alarm	BOLD	UTL	NLQ	10 cpi	15 cpi	20 cpi	Prop.	Cause / Treatment
Master CPU	-	-	On	-	-	-	On	Replace master CPU
Program ROM	-	-	On	-	-	On	-	Replace program ROM
Resident CG	-	-	On	-	-	On	On	Replace CG ROM
Option CG error	-	-	On	-	On	-	-	Replace Font Card
EEPROM Error	-	-	On	-	On	-	On	Replace EEPROM /TFCB
Master CPU Watch dog timer	-	-	On	-	On	On	-	Replace program ROM / TFCB
Slave CPU	-	On	-	-	-	-	On	Replace slave ROM
Slave CPU W.D.T. error	-	On	-	-	On	-	-	Replace slave firmware
External RAM Error	-	On	On	-	-	-	On	Replace External RAM
Option RAM error	-	On	On	-	-	On	-	Replace RAM Cart.
Print Overrun	On	-	On	-	-	-	On	Internal data transfer error
Print stop error	On	-	On	-	-	On	-	Space motor Slave CPU error
Print head homing	On	-	On	-	-	On	On	Print head failed to find home position
Slave CPU error	On	-	On	-	On	-	-	Replace Slave CPU / TFCB
Thermistor Error	On	-	On	-	On	-	On	Replace Printhead
Ribbon Error	On	-	On	-	On	On	On	Check ribbon homing mech.
EEPROM Error	On	-	On	On	-	-	On	Replace EEPROM TFCB
Spacing Error	On	-	On	On	-	On	On	Space motor Error
Bail arm error	On	-	On	On	On	-	-	Bail arm/sensor broken
Fan Alarm	On	On	-	-	-	-	-	PSU fan error
Bottom Feeder Alarm	On	On	-	-	-	-	On	Check bottom feeder