

## 810ex Error Display

Category	LCD Status Message	Trouble or Status		Remedy
		Code (nn)	Error	
Controller Errors	■ ERROR NN	0n	A fault occurred in the controller. n = Exception Code	Replace the Main Control PCB
		10	An error was detected by the program ROM check	Replace the Main Control PCB
		20	An error was detected by font ROM check.	Replace the Main Control PCB
		30	An error was detected by resident RAM check	Replace the Main Control PCB
		40	An error was detected by EEPROM check	- Replace the EEPROM or Main control PCB - EEPROM
		50	An error was detected by optional software ROM check	Check the optional software ROM board for proper connection or replace it
		60	An error was detected by optional RAM check	- Check the optional RAM board for proper connection. - Check the mounting position of short plugs and additional RAM chips (see 7.4) - Replace the option RAM board
		70	A fault occurred in the Fan motor.	- Check the fan motor for proper connection and for any presence of foreign matter in the fan (see 6.5.2) - Replace the fan or the Main Controller PCB
		71	A fault occurred in the fuser (timeout error).	See (6.5.2)
		72	A fault occurred in the fuser (thermistor open error)	See (6.5.2)
		73	A fault occurred in the fuser (thermistor short error)	See (6.5.2)
		74	Power supply board SSIO I/F error	Replace the power supply board of the Main Control PCB
		80	I/F time out occurred between the Main Control PCB and the operator panel.	- Check the operator panel for proper connection - Replace the flexible cable, operator panel or Main Control PCB